



Перв. примен.
Перв. примен.
Справ. №
Подп. и дата
Инв. № дубл.
Взам. инв. №
Подп. и дата
Инв. № подл.

Поз.	Наименование	Кол.	Примечание
XS1	FI-S20S with FI-C3-A1-15000 pins	JAЕ	1
XS2	DF19G-20S-1C(05) with DF19A-2830SCFA pins	Hirose	1

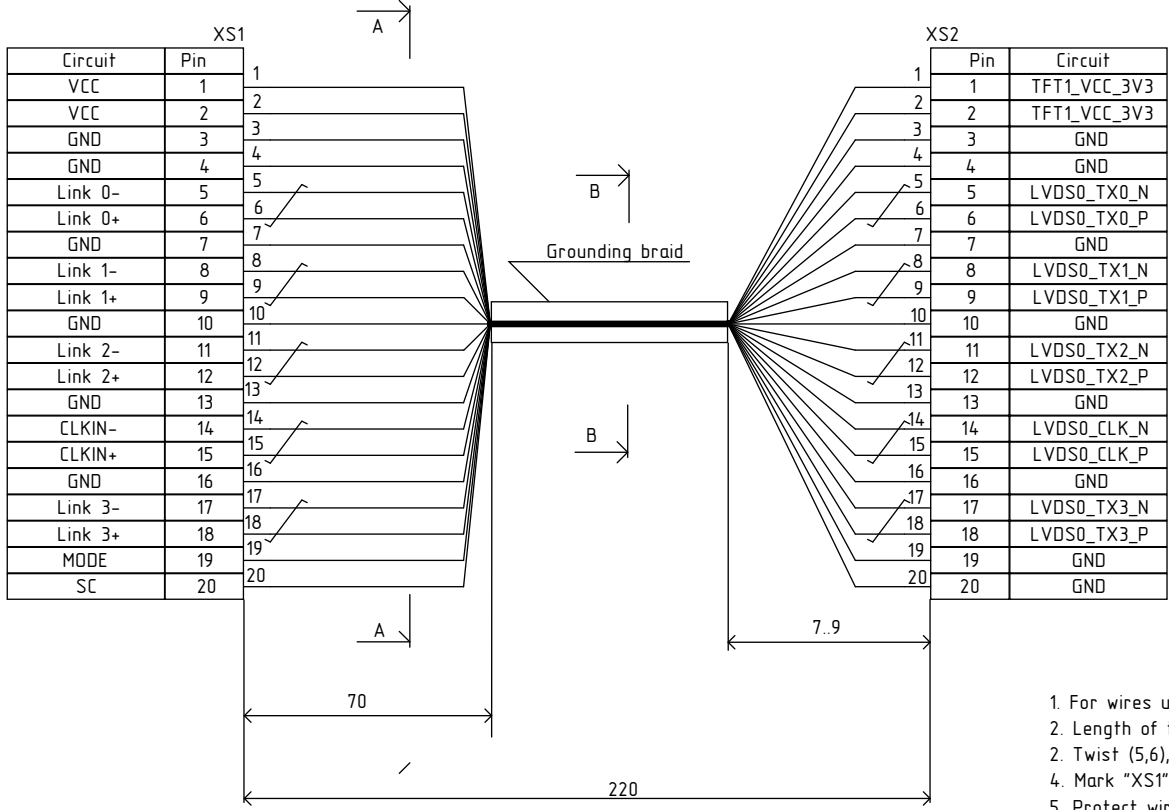

- For wires use 28 (7/36) AWG PTFE hook-up wire.
- Length of the cable 220 mm.
- Twist (5,6), (8,9), (11,12), (14,15), (17,18) pairs, step of the twist - 10.15 mm
- Mark "XS1", "XS2" connectors with white ink, height 3.5 mm, placement is not important.
- Protect wires with grounding braid. Placement of the braid - 70 mm from XS1 to 7.9 mm from XS2.
- Fix ends of the braid with a thread or heat-shrink tube.
- Unprotected part of the cable (70 mm) must be laid flat.

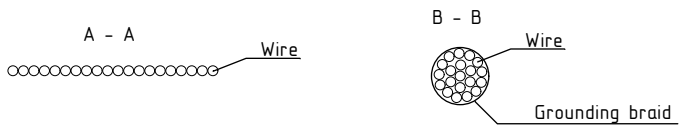

Изм.	Лист	№ докум.	Подп.	Дата	LVDS cable		
Разраб.							
Пров.							
Т.контр.							
Нач.сект.							
Н.контр.							
Утв.					Лит. Масштаб Масса		
					Лист Листов		